



OPENETICS

Instruction Manual P/N 2232


① Remove the Cable tie before installation.

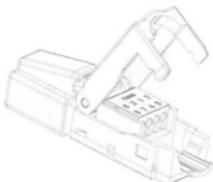


② Insert cable into strain relief boot, strip off 1.2 inch of cable jacket, fold back braid and drain wire.

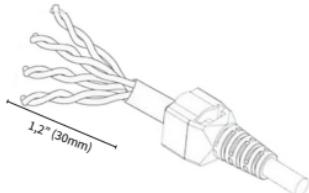

Boot adjustment
Cut the end of boot to fit your cable OD.

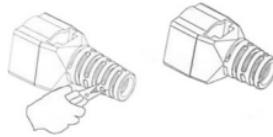


③ Fan out all four twisted pairs, following the color coding label and allocate each conductor into proper slots on wiring cap. Trim the ends of conductors.

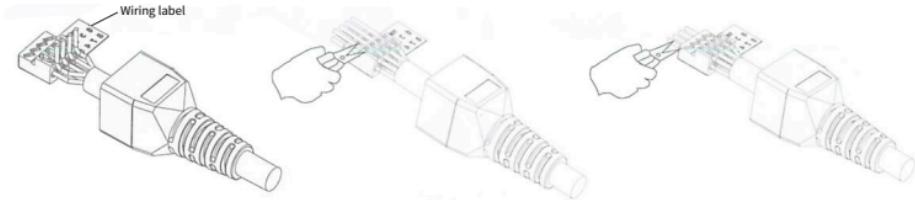


④ Place wiring cap on plug.

⑤ Place the wiring cap onto plug, use plier to clamp wiring cap until it completely snap-in to effect the connection.

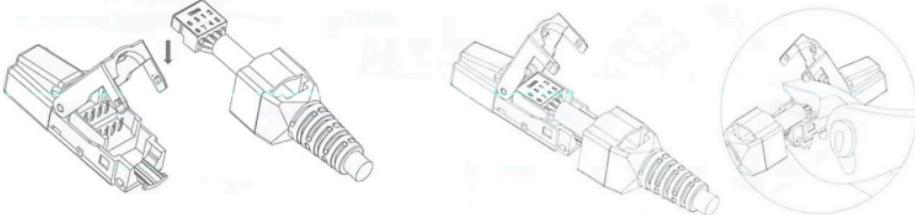


⑥ Close plug cover, make sure the drain wire is in proper contact with grounding clip on plug.
Pull back strain relief boot to cover the plug, fasten supplied cable tie to secure grounding contact.

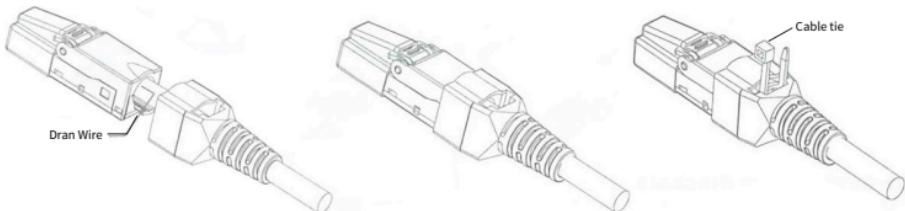

Unload the cable


Cut off cable tie, remove the boot. Using flat screw driver and pry gently on plug cover one end first and the other end subsequently to open it.

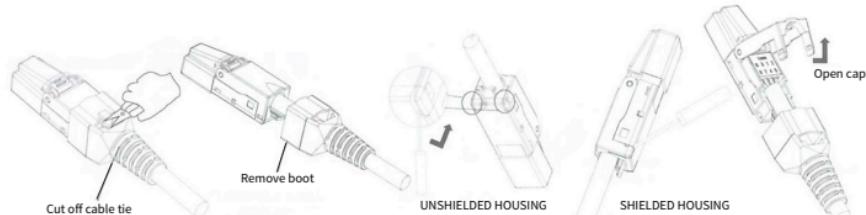

OPENETICS

Montageanweisung P/N 2232



① Vor der Montage Transportsicherung entfernen.

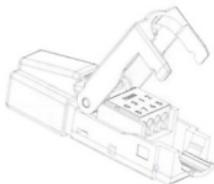


PIN Belegung	TIA/EIA T568A	TIA/EIA T568B
1	Weiβ/Grün	Weiβ/Orange
2	Grün	Orange
3	Weiβ/Orange	Weiβ/Grün
4	Blau	Blau
5	Weiβ/Blau	Weiβ/Blau
6	Orange	Grün
7	Weiβ/Braun	Weiβ/Braun
8	Braun	Braun

② Kabel in Knickschutzzüle einführen. Kabelmantel ca. 30mm absetzen, Schimgeflecht und Beidraht sorgfältig zurückbiegen.

Knickschutzzüle anpassen
Knickschutzzüle auf korrekten Kabeldurchmesser kürzen.

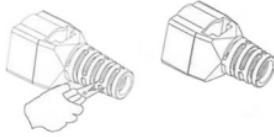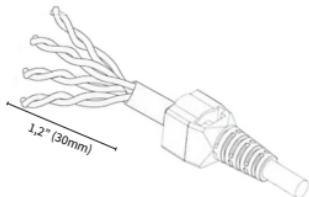


③ Kabeladämm aufdrehen und entsprechend Farbcode im Kabelmanager positionieren. Kabelenden kürzen.

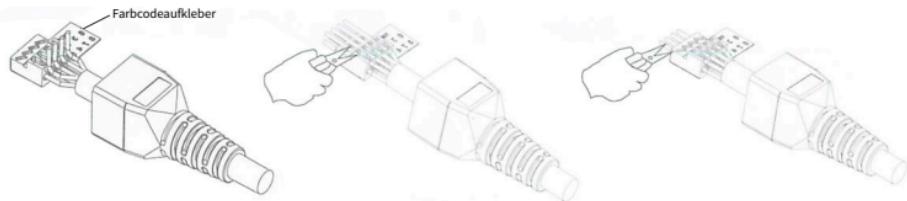


④ Farbcodeaufkleber entfernen.

⑤ Konfektionierten Kabelmanager auf Stecker positionieren und mit einer Zange fixieren bis dieser einrastet und eine sichere Verbindung gewährleistet.

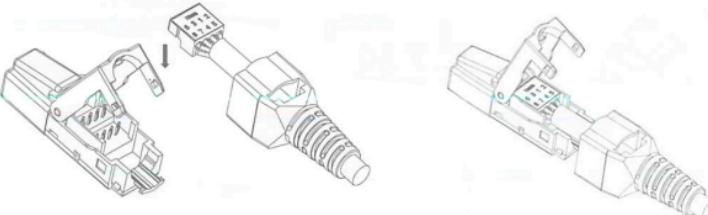

⑥ Steckerabdeckung schließen und sicherstellen, dass der beidraht einen guten Kontakt zum Gehäuse hat.

Knickschutzzüle über den Stecker schieben und mit Kabelbinder fixieren.

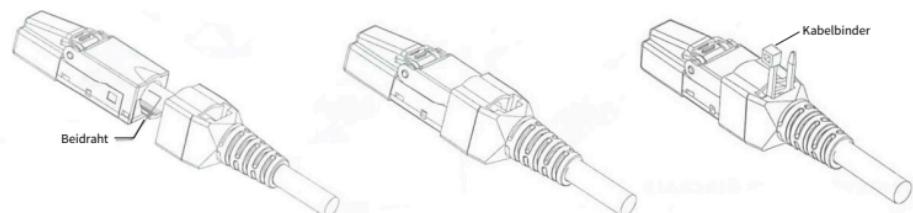

Demontage des Steckers

Kabelbinder entfernen und Knickschutzzüle zurück schieben. Mit einem flachen Schraubendreher die beiden Enden nacheinander aufhebeln und die Steckerabdeckung öffnen.

